

Date: Wednesday, 1/24/2007 4:46:25 PM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206L FWD X-TUBE
 Job Number : 30428
 Estimate Number : 10553
 P.O. Number : *N/A* Part Number : D206667103
 This Issue : 1/24/2007 S.O. No. : *N/A* Drawing Number : D206-667-143 REV B
 Prsht Rev. : NC Project Number : N/A
 First Issue : *N/A* Type : LANDING GEAR Drawing Revision : B
 Previous Run : 29630 Material : *N/A*
 Due Date : 2/28/2007 Qty: 1 Um: Each
 Written By : *[Signature]*
 Checked & Approved By : *[Signature]*
 Comment : Est Rev: 05.09.01 Add holes for compatibility with Bell
 Skidtubes KJJ/JLM

Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D206-667-103 CHG002

N/A *Prepared with WLD 33045*

2.0

D6002115

Crosstube material



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number

Description Batch

1" D6002-115

Crosstube

B25662

Check OD = 2.250"; ID = 1.750"

ml 07/02/05

3.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA087

2-Turn first side as per Folio FA087

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

ml 07/02/05

4.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

ml 07/02/05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries.

Date: Wednesday, 1/24/2007 4:46:25 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 30428

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA087

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143.

3-Remove sand and plugs

4-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-143

Inside of Cuff(Donot engrave on outside of tube)

W 07/02/05

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

W 07/02/05

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

MB 07/02/13

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Polish entire outside surface of crosstube

DP / M 07-02-13

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 2-2-13

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

DP / M 07-02-13

11.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D206-667-143 using CNC bender program 206L-fw and Folio FT017

EL / X 7-3-8

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 1/24/2007 4:46:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 30428

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

20703.12 (1)

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

- 1-Drill pilot holes in tube using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill all (3) top holes.
- 2-Drill and Ream all holes in tube to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Check dimensions between holes on all four sides.
- 3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.
- 4-Drill pilot holes using drill Jig DT8541 & DT8542 as per Dwg D206-667-143. Drill only the top (2) holes.
- 5-Drill & ream the top (2) holes to finish size using drill Jig DT8541 & DT8542 as per Dwg D206-667-143
- 6-Drill Fwd rivet holes using drill Jig DT8787FWD as per Dwg D206-667-143. Note: Fwd side has 3x top holes.
- 7-Drill Aft rivet holes using drill Jig DT8787AFT as per Dwg D206-667-143.
- 8-C'sink holes as per Dwg D206-667-143. Allow rivet to sit below surface to compensate for paint.
- 9-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-143

20703.13

20703.13

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

20703.13

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

20703.28 (1)

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

20703.28 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 1/24/2007 4:46:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 30428

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

OUTSIDE SERVICE

OUTSIDE SERVICES



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038Or

Issue P/O: 3440 LPI as per ASTM 1417

Level 2 Attach copy of NDT results to work order

CL 07/03/28 ①

18.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage

Ensure copy of NDT results attached to work order

CL 07/03/30 ①

19.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg D206-667-103

070302

20.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

RT 07-06-28

21.0

QC14

Inspect Spray Paint



Comment: Inspect Spray Paint

Wrap in plastic bag to protect from scratches

070629

①

22.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2138 f(s)/Unit Total: 1.2138 f(s)

Pick:

Qty Part number Description Batch

2 D2856-400(Cut to 6.94") Abrasion Strip

32020

RT 07-06-30

23.0

D2873043

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-043

Nut Plate

30449

RT 07-06-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 1/24/2007 4:46:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 30428

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

D2873045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2873-045

Nut Plate

30450

RT 07-06-27

25.0

D28911

Support 2.25 dia



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2891-1

Support

26715

RT 07-06-30

26.0

MS20601AD4W8



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part number Description Batch

14 MS20601AD4W8

Rivet

102850

RT 07-06-27

27.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-20

Clamp

102712

RT 07-06-30

28.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8579. .Note: (3) top holes should be facing up.

2-Install supports and clamps as per Dwg D4206-667-143. Torque clamps to 80-100 in lb

3-Install nut plates as per Dwg D206-667-143. Touch-up rivet heads with Imron paint.

RT 07-06-30

RT 07-06-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 1/24/2007 4:46:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 30428

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

30.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

31.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M15072 ✓

32.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch: M103446 ✓

33.0

AN57A

Bolt



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

10 AN5-7A

Bolt

M100826 ✓

34.0

AN530A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

4 AN5-30A

Bolt

M102473 ✓

35.0

AN960JD516

Washer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:Packing Kit

Qty Part number

Description Batch

18 AN960JD516

Washer

M103694 ✓

C 7/8/03 ✓

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 09/07/03

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 1/24/2007 4:46:26 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 30428

Part Number: D206667103

Job Number:



Seq. #:

Machine Or Operation:

Description :

36.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

PACKAGING RESOURCE #1

37.0

PACKAGING 1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-667-103 A

Location:

PPP Rev:

PPP

B 33044

CSA

38.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

107103/03

Job Completion



N 07-07-03

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 30428
Description: Crosstube Assembly (206L High Fwd)	Part Number: D206-667-143
Inspection Dwg: D206-667-143 Rev: B	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST


☒ First Article
 ☐ Prototype

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.240	/			
	1.982	+0.005/-0.000	1.985	/			
	2.019	+0.005/-0.000	2.023	/			
	2.058	+0.005/-0.000	2.062	/			
	2.097	+0.005/-0.000	2.101	/			
	2.136	+0.005/-0.000	2.140	/			
	2.176	+0.005/-0.000	2.180	/			
	2.201	+0.005/-0.000	2.206	/			
	0.125	+/-0.010	0.130	/			
	0.400 x 30°	+/-0.010	0.400x30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			
SIDE B	104.98	+/-0.020	105.00	/			
	2.240	+0.005/-0.000	2.241	/			
	1.982	+0.005/-0.000	1.985	/			
	2.019	+0.005/-0.000	2.024	/			
	2.058	+0.005/-0.000	2.063	/			
	2.097	+0.005/-0.000	2.101	/			
	2.136	+0.005/-0.000	2.140	/			
	2.176	+0.005/-0.000	2.180	/			
	2.201	+0.005/-0.000	2.205	/			
	0.125	+/-0.010	0.129	/			
	0.400 x 30°	+/-0.010	0.400x30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			

Measured by: <i>mf</i>	Audited by: <i>MB</i>	Prototype Approval:	N/A
Date: 07/02/05	Date: 07/02/13	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	<i>[Signature]</i>

Crosstube Bend Dimension Sheet

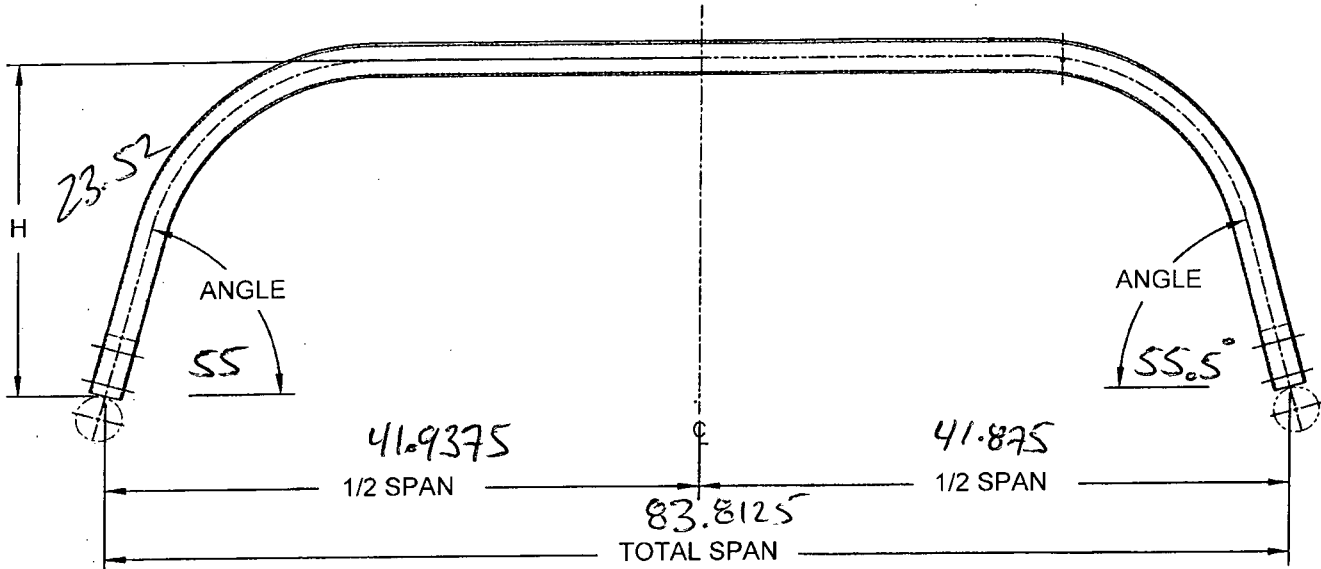

PART NUMBER: 206-667-103

BATCH NUMBER: 30428

DRAWING: 206667143 REVISION: B

H: 23.52

1/2 SPAN: 41.92 ✓

TOTAL SPAN: 83.84 ✓

ANGLE: 54°

QC 15: [Signature]

DATE: 07-03-12

QTY: 1



DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED HDS	APPROVED HDS	DRAWING NO. D206-667-143	REV. B SHEET 1 OF 3
DATE 05.07.26		TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	SCALE NTS
A	00.11.17	NEW ISSUE	
B	05.07.26	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

05-07-26

UNDER REVIEW

05.07.26 PH

re-draw detail F

PH
07.01.25

Qty	Part Number	Description
X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
1	D6002-115	CROSSTUBE
2	D2873-043	NUT PLATE
2	D2873-045	NUT PLATE
2	D2856-400-694	ABRASION STRIP
2	D2891-1	SUPPORT
14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
4	MS21920-20	CLAMP







GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6002-115
FINISHED LENGTH = 104.98±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-694 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2891-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKA FLEX 241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

STAMP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 30428

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

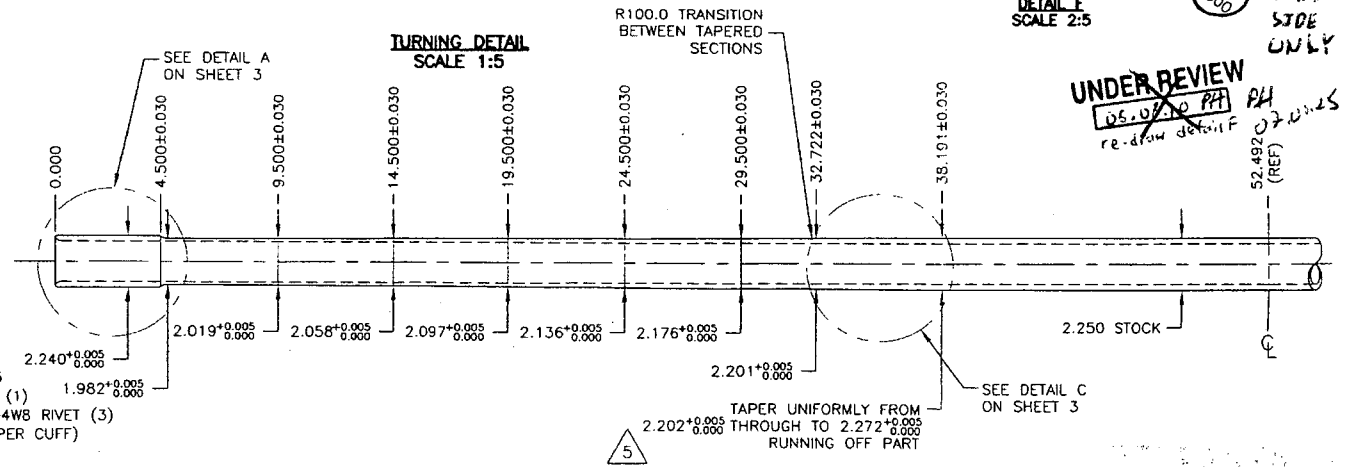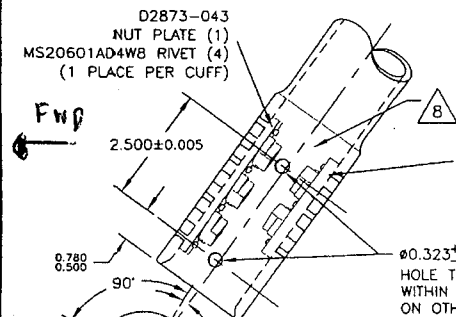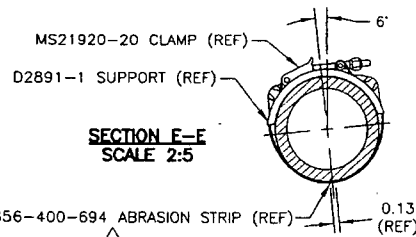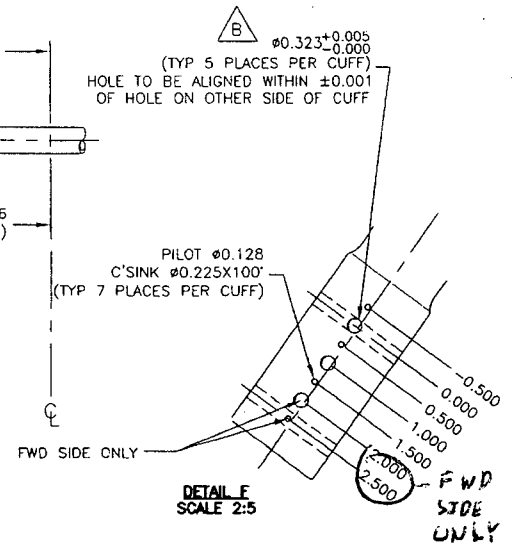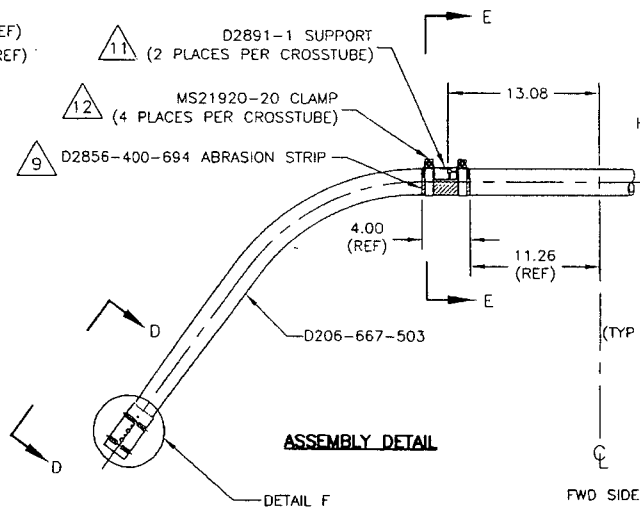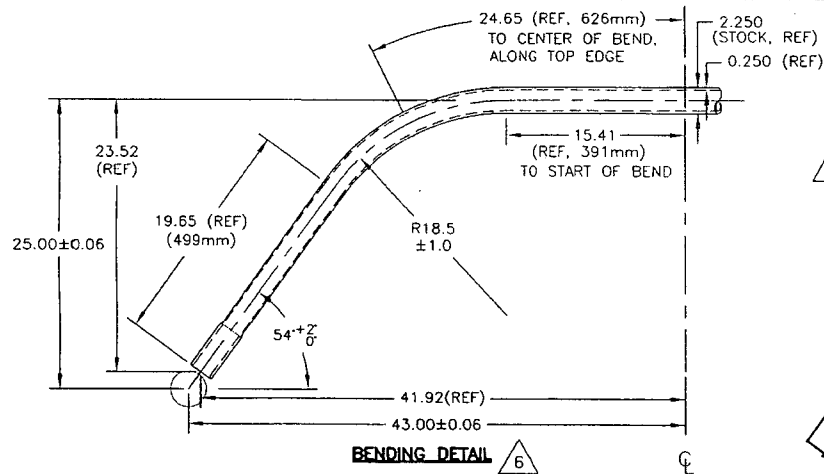


UNDER REVIEW
05.07.26 PH
re-draw detail F
PH 07.07.26

NO. 30428
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
CONTROLLED COPY
RETURN TO
ENGINEERING
SHOP COPY
RETURN TO


COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	DART DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		PH	PH	DRAWING NO.	REV. B
CHECKED		PH	PH	D206-667-143	SHEET 2 OF 3
DATE		05.07.26		TITLE	SCALE
				CROSSTUBE ASS'Y (206L HIGH FWD)	1:10

DETAIL A: CROSSTUBE CUFF

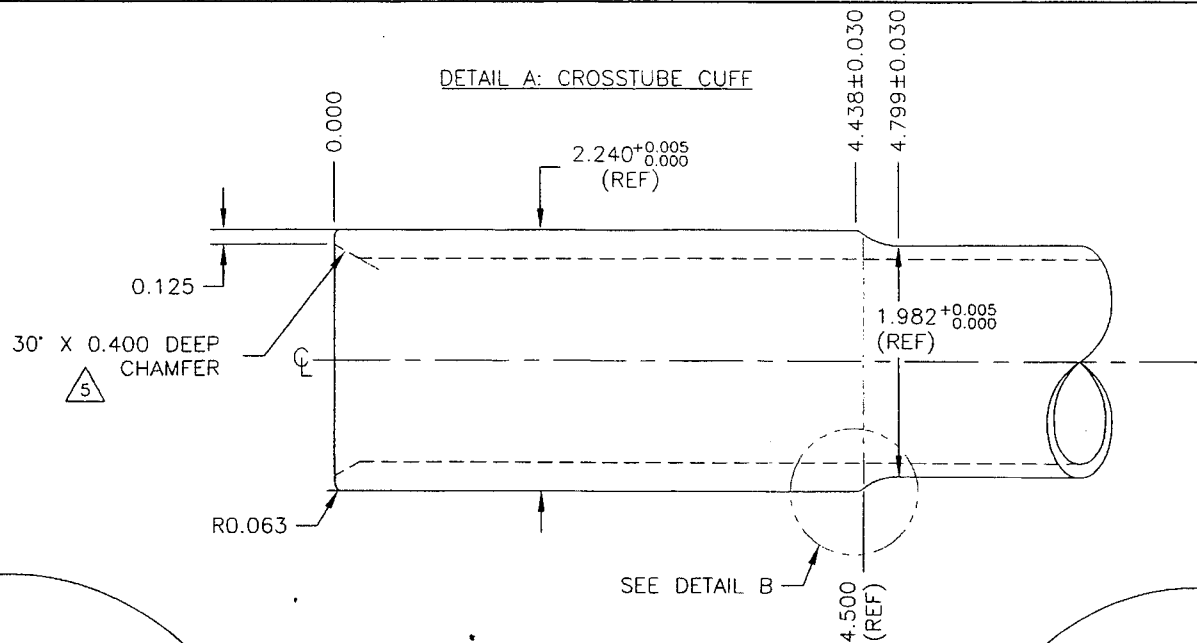


05.07.26 #

~~UNDER REVIEW~~
20.08.10 PH
re-draw detail F
PH
07.01.25

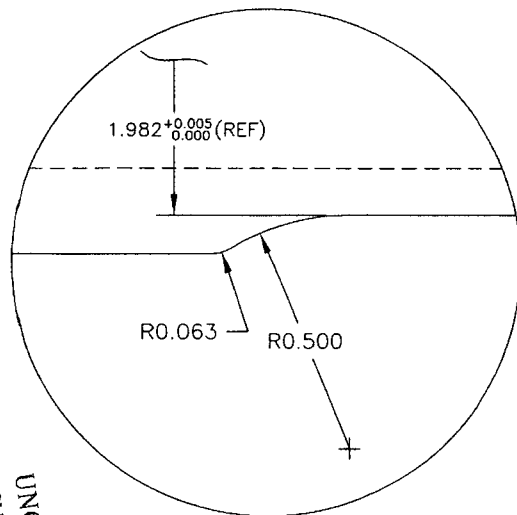


DETAIL B: CUFF
TRANSITION
SCALE 4:1

DETAIL C:
TAPER RUN-OFF
NOT TO SCALE

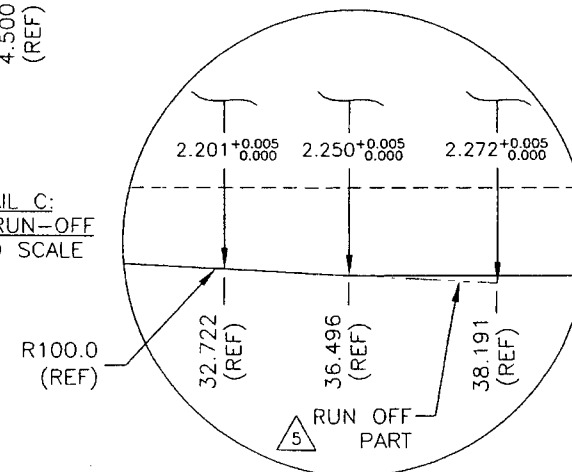

NO. 30428
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	PH	DRAWN BY	PH	DART DART AEROSPACE LTD. HAMPSHIRE, ENGLAND, CANADA	REV. B
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	PH	APPROVED	PH	DRAWING NO. D206-657-143	SHEET 3 OF 3
		DATE	05.07.26			TITLE CROSSTUBE ASS'Y (206L HIGH FWD)	SCALE 1:1

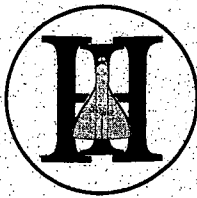

HeathAir

INTERNATIONAL (1991) INC.

681 Ave. Lepine, Dorval, Québec H9P 1G3
Tél.: (514) 636-1000 • Fax: (514) 636-0031

W.O. N° 36061

A.M.O. Number: 46/90

NON-DESTRUCTIVE TESTING REPORT

AIRCRAFT / COMPONENT INFORMATION

REGISTRATION:

MODEL/TYPE:

SERIAL NUMBER:

TOTAL HR/LDG:

OPERATED BY:

BASED AT:

INSPECTION REQUIREMENTS

Carry out FPI of seven (7) cross tubes (external surface) as per ASTM E-1417-05 and the Dart QSI 038, Section 4.1.1 (on file at client) - parts delivered to HeathAir.

Qty. (2) P/N D412-664-145 S/N's B31137 & B31138

Qty. (1) P/N D206-667-103 S/N B30428

Qty. (2) P/N D412-664-203 S/N's B30427 & B30425

Qty. (2) P/N D206-667-101 S/N's B30439 & B30437

207/03/30

☐ RADIOGRAPHY

☐ ULTRASONIC

☒ PENETRANT

☐ MAGNETIC PARTICLE

☐ EDDY CURRENT

INSPECTION REPORT

Fluorescent penetrant inspection was performed in accordance with the above requirements on seven (7) cross tubes.

Note: A Level 3 penetrant was substituted for the requested Level 2 (3 is more sensitive) Ardrex 970P25E Batch #04B503.

Seven (7) cross tubes PASSED inspection.

THE MAINTENANCE DESCRIBED ABOVE HAS BEEN PERFORMED IN ACCORDANCE WITH
THE APPLICABLE STANDARDS OF AIRWORTHINESS

INSPECTED BY:

S. FLETCHER

DATE March 29, 2007

INSPECTION Not Required
STAMP(S)

CUSTOMER INFORMATION

CUSTOMER: Dart Aerospace

P.O. NUMBER

3440

ADDRESS:

CONTACT NAME:

LABOUR @

\$

MATERIALS @

TRAVEL EXPENSES @

GST

HOTEL EXPENSES @

PST

INVOICE NO.

TOTAL \$

WHITE COPY - INSPECTION FILE • YELLOW COPY - CUSTOMER • PINK COPY - ACCOUNTANT

